INDEPENDENT

## **BATTERY CERTIFICATE**



CERTIFICATE NUMBER: E1688A3F-339A-4160-B2B1-E439545A92E9

VEHICLE

**BRAND:** BMW


MODEL: i3 - 120 Ah


MILEAGE: 100,241 km

VIN: WBY8P210907F92919

**DATE AND TIME:** 03.10.2025, 08:45:28

**EXECUTED BY:** AAA Auto

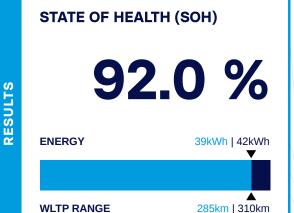

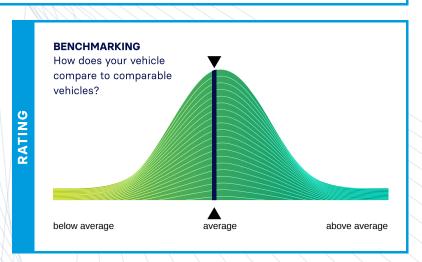

Battery Management System (BMS)

Battery Sensor

Battery Measurements

Battery Cell Voltages

Vehicle Communication



LUATION

## **GOOD HEALTH - NO ABNORMALITIES DETECTED**

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in good condition.

The drive battery is therefore officially AVILOO Certified.

horans Reiger

Dr. Marcus Berger, CEO





}.		Gross	Net (Nominal)	Usable
ENERGY	Current:	41.4kWh	38.8kWh	36.1kWh
III	New:	45.0kWh	42.2kWh	39.3kWh

w.		WLTP	Typical
RANGE	Current:	230-285km	192km
8	New:	250-310km	209km

OL	AVILOO Box connected.	08:45:24
00	FLASH Test started.	~
PROTOCOL	Vehicle detected.	<b>✓</b>
	Starting data acquisition.	~
EXECUTION	Finished data acquisition.	<b>✓</b>
CU	Analyzing data.	<b>✓</b>
X	Analysis completed.	~

Voltage Sensor	•
Current Sensor	~
Temperature Sensors	•
Cell Voltage Sensors	•

		Value	Status
BMS	BMS State of Charge (SoC)*:	61%	
	SoC calculation accuracy:		~
	BMS State of Health (SoH)*:	97%	
	SoH calculation accuracy:		~

	Min	Max	Delta	Status
Battery Temperature	7.0°C	8.0°C	1.0°C	~
Cell Voltage	3.722V	3.727V	5mV	~
Pack Voltage	357.4V			
Average Current	-17.6A			

\*The values shown here were not calculated by AVILOO but correspond to the values read out from the battery management system (BMS) and were calculated by the manufacturer. AVILOO therefore assumes no liability for their accuracy.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOOs algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Managament System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.