

INDEPENDENT BATTERY CERTIFICATE



CERTIFICATE NUMBER: 472FB54A-0CA0-4676-8565-52727D80D227

VEHICLE

BRAND: Volkswagen
MODEL: ID3 - 58 kWh

MILEAGE: 65,214 km
VIN: WVVZZZE1ZLP001798
DATE AND TIME:
02.08.2025, 19:55:25

EXECUTED BY: AURES Holdings

RESULTS

STATE OF HEALTH (SOH)

91.6 %

ENERGY

53kWh | 58kWh




WLTP RANGE

389km | 425km

RATING

BENCHMARKING

How does your vehicle compare to comparable vehicles?

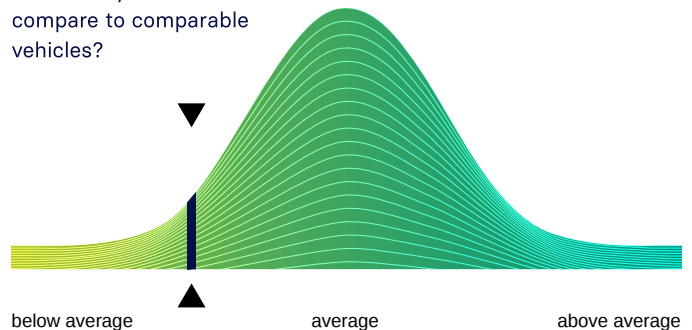

CHECKS

Battery Management System (BMS) ✓

Battery Sensor ✓

Battery Measurements ✓

Battery Cell Voltages ✓

Vehicle Communication ✓



SCAN FOR DETAILS

EVALUATION

GOOD HEALTH - NO ABNORMALITIES DETECTED

Based on the detailed battery diagnostics performed with the AVILOO FLASH Test, we hereby certify that the drive battery of this vehicle is in good condition.

The drive battery is therefore officially AVILOO Certified.

Marcus Berger

Dr. Marcus Berger, CEO



ENERGY

	Gross	Net (Nominal)	Usable
Current:	56.8kWh	53.1kWh	49.5kWh
New:	62.0kWh	58.0kWh	54.0kWh

RANGE

	WLTP	Typical	Individual
Current:	389-389km	288km	258km
New:	425-425km	315km	281km

EXECUTION PROTOCOL

AVILOO Box connected. 19:55:22

FLASH Test started.	✓
Vehicle detected.	✓
Starting data acquisition.	✓
Finished data acquisition.	✓

SENSORS

Voltage Sensor	✓
Current Sensor	✓
Temperature Sensors	✓
Cell Voltage Sensors	✓

BMS


	Value	Status
BMS State of Charge (SoC)*:	94%	
SoC calculation accuracy:		✓
BMS State of Health (SoH)*:	89%	
SoH calculation accuracy:		✓

MEASUREMENTS

	Min	Max	Delta	Status
Battery Temperature	23.3°C	24.3°C	1.0°C	✓
Cell Voltage	4.049V	4.089V	39mV	✓
Pack Voltage	441.1V			
Average Current	-0.5A			

CELL VOLTAGES DIAGRAM

	1	2	3	4	5	6	7	8	9	10	11	12	13	14	15	16	17	18	19	20
1 - 20	4.084	4.081	4.087	4.085	4.085	4.085	4.084	4.081	4.085	4.085	4.084	4.084	4.088	4.084	4.084	4.083	4.085	4.084	4.085	4.084
21 - 40	4.083	4.084	4.084	4.086	4.085	4.082	4.087	4.085	4.085	4.083	4.085	4.082	4.085	4.082	4.085	4.049	4.085	4.082	4.084	4.084
41 - 60	4.085	4.085	4.085	4.084	4.084	4.083	4.086	4.087	4.086	4.084	4.083	4.081	4.084	4.086	4.087	4.084	4.086	4.086	4.086	4.087
61 - 80	4.089	4.085	4.086	4.087	4.085	4.085	4.086	4.086	4.087	4.083	4.085	4.088	4.089	4.084	4.088	4.085	4.085	4.084	4.086	4.086
81 - 100	4.085	4.085	4.087	4.089	4.085	4.084	4.085	4.085	4.085	4.083	4.085	4.083	4.085	4.085	4.086	4.087	4.086	4.082	4.085	4.084
101 - 108	4.083	4.085	4.085	4.083	4.084	4.084	4.085	4.085	/	/	/	/	/	/	/	/	/	/	/	/

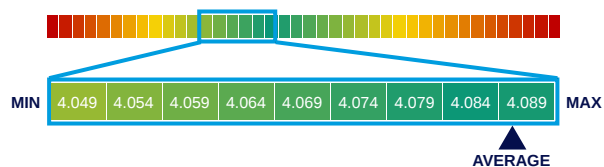

*The values shown here were not calculated by AVILOO but correspond to the values read out from the battery management system (BMS) and were calculated by the manufacturer. AVILOO therefore assumes no liability for their accuracy.

DISCLAIMER: The test result includes the currently calculated state of health (SoH) of the drive battery. The determination is based on data provided by the vehicle. These are evaluated by AVILOO's algorithms using statistical and analytical models. Manipulation of the data in the control unit leads to an incorrect result. The indicated SoH has a technically induced fluctuation range (deviation) of no more than 3% in at least 95% of reference measurements. It should be noted that this tolerance applies to the SoH determination at the cell level and not to the SoH of the entire battery. This is because the state of charge of individual cells may vary, which can negatively affect the current SoH of the battery. However, this can be compensated by the Battery Management System (BMS) or during a calibration. The result reflects the condition of the battery at the time of the test. No conclusions can be drawn about the future state of health of the battery from this. Statements about mechanical damage or external influences are not part of this diagnosis.